



## Customer Service Bulletin Commercial Business Group

---

### Reelmaster<sup>®</sup> 2300 and 2600 3WD

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	03426	50001-69999
	03427	60001-80577

**Subject: Reducing hydraulic noise in reverse with 3WD engaged.**

When backing up with an engaged 3WD system, the units listed above may generate an objectionable hydraulic noise. Although this noise is not known to cause problems or other failures, it may be objectionable to operators.

To reduce or eliminate this noise, replace the Flow Control Valve with Flow Control Valve (99-2322) and (2) Fittings (340-4). The new valve has greater capacity which reduces or eliminates this noise. The valve body has a larger profile requiring the larger fittings. Ensure valve orientation is the same as illustrated below. Incorrect orientation will disable the traction circuit.

