



Customer Service Bulletin Commercial Business Group

Workman[®] 3000/4000 Series

Date: October 18, 2004

<u>Model/Serial Range:</u>	<u>Model Numbers:</u>	<u>Serial Numbers:</u>
	07360	240000101 - 240000210
	07361	240000101 - 240000598
	07362	240000101 - 240000285
	07362TC	240000101 - 240000325
	07363	240000101 - 240000228
	07364	240000101 - 240000170
	07364TC	240000101 - 240000181
	07365	240000101 - 240000199

Subject: Front End Noise

The unit may exhibit grinding or popping noise from the front end of the vehicle, typically during braking and in turns. This can be caused by contact between the outer flange of Brake Drum (93-7128) and inside diameter of Front Rim ASM (87-5720). If the interference is substantial, the Front Rim may not fully seat against the Brake Drum and the two parts may wedge in place, making separation difficult.

Replacement of Brake Drum will correct this issue. Current parts inventory of Brake Drum (93-7128) have been modified and are available to correct this issue. The existing drums can be machined down to reduce the outer diameter if timing to obtain new parts is not a viable option. If you require assistance, please contact your local Toro Commercial Products Distributor for complete information on this issue.