



Customer Service Bulletin Commercial Business Group

Workman[®] 3000/4000 Series

Date: June 23, 2004

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	07211 - 07211TC	220000101-230099999
	07212 - 07212TC	220000101-230099999
	07213 - 07213TC	220000101-230099999
	07214 - 07214TC	220000101-230099999
	07217 - 07217TC	220000101-230099999
	07218 - 07218TC	220000101-230099999
	07360 - 07360TC	240000101-240099999
	07361 - 07361TC	240000101-240099999
	07362 - 07362TC	240000101-240099999
	07363 - 07363TC	240000101-240099999
	07364 - 07364TC	240000101-240099999
	07365 - 07365TC	240000101-240099999

Subject: The Auxiliary Power Unit Driveshaft does not fit.

The Auxiliary Power Unit (APU) Driveshaft (105-4234-03 or 92-2618-03) is too long in certain applications.

When fitting the High Flow Hydraulics Kit (07228) and the appropriate APU Electric Clutch Kit (07399/07401/07402/07404), two of Coupler-Rubber (44-2230) are required on both ends of Driveshaft due to heavy loads. When the Pulley (105-1741) which is required to drive the High Flow Hydraulics is added to the Engine Crankshaft Pulley, the driveshaft supplied is too long.

Driveshaft (108-3068-03) is available when the driveshaft supplied is too long.

Detailed information on application of Driveshaft (108-3068-03) is currently available from your local Toro Commercial Products Distributor. Toro Commercial Products Service bulletins can be found on the Internet at www.toro.com.