

Rotaries #14-56

Gearbox Breather Vent Leaks

Product: Groundsmaster® 3280 Decks		October 20, 2016
Affected Units:	Models:	Serial Numbers:
	30366	316000101-316009999
	30368	316000101-316009999
	30403	316000101-316009999
	30404	316000101-316009999
	30555	316000101-316009999
	31335	316000101-316009999
	31336	316000101-316009999

Situation:


2016 Groundsmaster 3280 mowing deck gearboxes have been reported to experience minor leakage of the gear oil at the Breather Vent Assembly. It has been determined that the Gearbox Assemblies are missing Copper Washer (130-4899) between the Breather Cap and the elbow fitting.

Instructions:

Please contact your Toro Commercial Products Distributor for assistance to obtain and install Copper Washer. Reference Service Bulletin Rotaries 14-56, "Gearbox Breather Vent Leaks", dated September 30, 2016 when making your inquiry.

Washer Installation Instructions:

- 1. Remove the Breather Vent from the Elbow fitting.
- 2. Install Washer-Copper (130-4899) between the elbow fitting and the Breather Cap.
- Maintain the 50 degree angle on the Elbow Fitting; the Breather Vent cannot protrude above the Gearbox housing.
- 4. Torque the assembly to 11.3 Nm (100 in./lbs.).
- 5. Check the gear oil level.

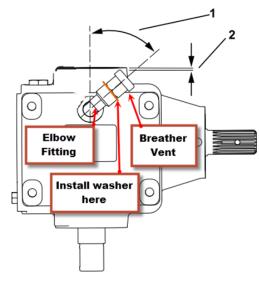

2. No more than 1.78 mm (0.07 inch)