



Customer Service Bulletin Commercial Business Group

SAFETY ALERT



Greensmaster® 800, 1000, and 1600 Products

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	04048	80101-210000180
	04048TE	80101-90109
	04052	50101-210000689
	04052TE	60101-210000195
	04060	60101-210000439
	04060TE	60101-210000122

Subject: Fuel Tank Leaks at Seam.

In rare instances, combinations of engine operating speed, conditions, engine performance characteristics, and other elements may contribute to the separation of the Fuel Tank welded seam. Replacement Fuel Tank (104-2382) is now produced using a thicker material to resist these effects. Should this type of failure occur, it is also recommended to install Tank Bracket (104-2383) in place of the existing mounting bracket. This improved bracket is specifically designed to counter the combined effects that can cause this uncommon condition. Several decals are also needed to complete the Fuel Tank assembly.

Contact the local Toro authorized distributor in your area for additional information regarding this bulletin.

Warning:

Failure to remedy a fuel leak may cause turf damage and could result in product damage, property damage, or personal injury.

