



## Customer Service Bulletin Commercial Business Group

---

### Greensmaster® 800, 1000, 1600 Product

Date: May 14, 2002

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	04048	00000-220009999
	04050	00000-220009999
	04051	00000-220009999
	04052	00000-220009999
	04060	00000-220009999

**Subject: Availability of alternate Reel Bearing Seals.**

These greens mowers use a single lip seal in the reel bearing application. The original seal is effective in its intended purpose of retaining grease, however a service seal with two additional lips is now available for improved performance against the entry of moisture. When servicing your reels you may wish to consider using replacement Service Seal (104-3388). Be sure to coat the seal lips heavily with grease during installation for best results and to prevent damage to the seal lips at start up. This part is available through your local Toro distributor.

Note: Even with the replacement Service Seal installed, Reel bearings require grease at 25-hour intervals. In addition, grease fittings should be immediately lubricated if the unit is washed to purge any moisture from behind the seals. Failure to do so can result in contamination of the bearing bore that will cause rust, corrosion, and premature bearing failure.