



## Customer Service Bulletin Commercial Business Group

---

### Reelmaster® 6500-D and 6700-D

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	03800	50001-60632
	03801	50001-60343
	03802	60001-60367

**Subject: Inconsistent or erratic Backlap speed.**

A replacement Variable Speed (VS) Hydraulic Cartridge (95-3459) is now available to provide greater control over the backlap function. If the issue persists after verification of the following checkpoints, both original Variable Speed Cartridges should be replaced with an improved version. The improved Cartridges provide a greater range of internal movement for better control of hydraulic oil flow during backlapping. Contact your local Toro distributor for further details.

Inspect these items first.

1. Proper adjustment of Reel-to-Bedknife (light contact required).
2. Engine at correct low (idle) RPM specification.
3. HOC Selector properly calibrated and set to desired backlap speed position.
4. Proper operation of the Reel Speed Sensors.

**NOTE:** An inoperative Reel Speed Sensor is a commonly found fault.