



Customer Service Bulletin Commercial Business Group

Reelmaster[®] 5, 7, & 11 Blade Reel

<u>Model/Serial Range:</u>	<u>Model Numbers:</u>	<u>Serial Numbers:</u>
	01005	200000101-210000249
	01007	200000101-210000932
	01011	200000101-210000251

Subject: Ring Gear Hub (95-1828) Leaks Gear Oil.

The holes used for attaching the wheels to the mower may have been machined incorrectly. This condition has been found to cause gear lubricant leakage due to improper sealing of the wheel.

If the four tapped bolt holes in the Ring Gear Hub (95-1828) have been drilled short of the specified minimum 0.687" (17.5 mm) depth, the wheel will not seat fully. In addition, these holes may have been tapped for 8 mm diameter bolts rather than 5/16-18 NC thread required; the threads could be damaged.

Contact your Toro Commercial Distributor if either of these conditions are found.

The listing of Hub Assembly (2-4599), which includes Ring Gear Hub (95-1828), was accidentally left out of the 2001 Reelmaster Parts Catalog. This assembly will appear in future Reelmaster Parts Catalogs.

This assembly is available from your Toro Commercial Distributor.

