



Customer Service Bulletin Commercial Business Group

SAFETY ALERT



MultiPro® 1100

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
	41105	70193-70400

Subject: Rear Wheel Brake System Factory Rework Program.

The brake manufacturer has notified us of a machining flaw that may lead to failure of the braking system on the units listed above (see exempt units below).

Exempt Units:

Serial Numbers 70332, 70336, 70365, 70373, 70377, 70381-70397, 70399 and 70400 have been corrected and are not affected by this notice.

Warning: Failure to comply with this notice could result in personal injury, property damage, and/or damage to the machine.

A non-machined area in the cylinder bore of Torque Spider (24-9530) may allow a small amount of brake fluid to by-pass the Wheel Cylinder Piston Seal each time the brakes are applied. This condition will damage the Piston Seal causing a loss of braking force and may result in a total loss of braking.

Contact your local Toro distributor for details regarding the Factory Rework Program to correct this issue.