



## Customer Service Bulletin Commercial Business Group

---

### Workman® 3000 and 4000 Series

Date: January 27, 2004

<u>Model/Serial Range:</u>	<u>Model Numbers:</u>	<u>Serial Numbers:</u>
	07211	220000101-230099999
	07212	220000101-230099999
	07218	220000101-230099999

#### **Subject: Engine hesitation, abrupt or “jerky” acceleration.**

Hesitation or abrupt/jerky acceleration may occur when accelerating after shifting from 1<sup>st</sup> to 2<sup>nd</sup> gear or after coasting the vehicle on idle and resuming acceleration.

Complaints of hesitation off low idle and abrupt acceleration have been expressed.

If this issue exists, Throttle Kit (107-7970) is intended to improve the governor's ability to operate smoothly. The Kit includes a modified governor bell crank assembly, governor spring and instructions to correctly adjust the throttle cable. Vehicle low idle specification has been amended to be adjusted to 1100 ± 50 RPM on all Workman models listed in this bulletin. Please update your Operator's Manual and Service Manual to capture this engine idle speed specification change.

Throttle Kit (107-7965) is currently available through your local Toro Commercial Products Distributor.