



# Customer Service Bulletin Commercial Business Group

## Workman® 3000/4000 Vehicles

November 6, 2006

<u>Model/Serial Range:</u>	<u>Model Number:</u>	<u>Serial Numbers:</u>
Workman 3100	07210 / 07214	40001-230999999
Workman 3120/3220	07232 / 07231	90001-99999
Workman 3200	07200 / 07200TC / 07202	30001-210999999
Workman 3200	07211 / 07211TC / 07212	220000001-230999999
Workman 3210	07220	90001-210999999
Workman 3300-D	07205 / 07205TC	30001-210999999
Workman 3300-D	07213 / 07213TC	220000001-230999999
Workman 3310-D	07222	80001-200999999
Workman 3320-D	07230	90001-99999
Workman 3420	07233	90001-99999
Workman 4200	07216/07218	50001-230999999
Workman 4300-D	07215 / 07215TC	50001-210999999
Workman 4300-D	07217 / 07217TC	220000001-230999999

### Subject: Deformed and Cracked Seat Base

The seat base may deform over time and cause the fender to separate from the mounting surface. Reinforcement Plate (107-7952-03) is now available and may be added to the inside of the seat base to draw the area flat. Even if some damage to the seat base is present, the clamping force of the assembly and the remaining integrity of the seat base will be sufficient to salvage the seat base. Screw (3250-23) is suggested to replace the existing screws, as it is slightly longer to accommodate the thickness of the added plate and eases assembly of the warped parts. The picture below highlights the area involved.

