



Lift Arm Pivot Hardware Loosens Repeatedly

Product: Reelmaster 5010 Series

April 3, 2010

Affected Units:

Reelmaster 5010 Series

Models:

03660

03670

03680

03690

Serial Numbers:

260000101 – 280999999

260000101 – 280999999

260000101 – 280999999

260000101 – 280999999

Situation:

The hardware that retains #1 and #4 lift arms can become loose. This hardware must remain tight. Service Bulletin Large Reels #02-09 addresses the issue of loosening hardware and the need to periodically verify hardware torque. In some instances components may have worn, which can allow hardware to loosen more frequently.

Instructions:

A kit has been developed to reinforce this area which resists movements that lead to hardware loosening. When repairs are being made to this area, the use of Frame Support Kit (119-6961) is recommended.

