



## Incorrect Location of Leak Detector Breather

**Product: Greensmaster® 3300**

**Dec 4, 2012**

**Affected Units:**

**Models:**

**Serial Numbers:**

04510

3120000001 – 3120000513

**Situation:**

Hydraulic fluid residue could build up on the hydraulic tank from a leaking breather. The Breather (115-9793) on the Greensmaster® 3300 should be located on the Leak Detector Tank (115-8242) while a Plug (354-74) should be on the Hydraulic Tank (115-9822). Some units mistakenly had the breather installed on the hydraulic tank and the plug on the leak detector tank. Below is a picture of a breather installed incorrectly on the hydraulic tank. Note: Failure to make this change may cause a leak or prevent the leak detector to function properly.

### INCORRECT SET UP





## Incorrect Location of Leak Detector Breather

**Correction:** If the breather is installed on the hydraulic tank, remove the breather from the hydraulic tank and remove the plug (using a 1-¼” wrench) from the leak detector tank. Install the breather on the leak detector tank and install the plug on the hydraulic tank. Do not use a thread sealant. Below is a picture of a breather installed correctly on the leak detector tank.

Contact your TORO Distributor with any questions regarding this repair.

### CORRECT SET UP

