



Carburetor Sediment Bowl Breaks When Removed

Product: Greensmaster® Walk Mowers

January 17, 2014

Affected Units:

- Greensmaster 1010
- Greensmaster 1610
- Greensmaster 2100
- Greensmaster 1800
- Greensmaster 800
- Greensmaster 1000
- Greensmaster 1600

Models:


- 04038
- 04039
- 04040
- 04041
- 04054
- 04055
- 04056

Serial Numbers:

- 313000101-314009999
- 313000101-314009999
- 312000101-314009999
- 312000101-314009999
- 312000101-314009999
- 312000101-314009999
- 312000101-314009999

Situation:

Removing the fuel sediment bowl can result in fracture of that plastic component. (Item 303)

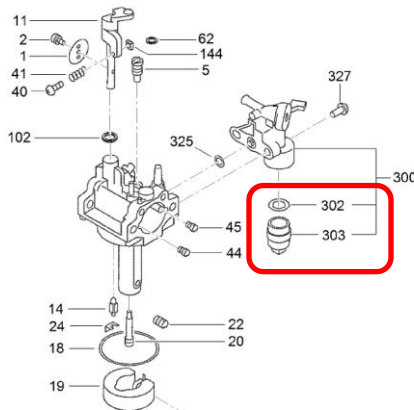

Correction:

The engine manufacturer is evaluating the issue and modifications are pending. As an interim resolution, it is recommended to use a 12 point 17 mm socket to remove the cup for inspect and maintenance process. Tightening method: Temporarily (hand) tighten for 2 to 3 rotations, then tighten by low range torque wrench. The torque spec is: 15.9 in/lbf ± 2.65 in/lbf (1.8 Nm +/- 0.3 Nm)

Please contact your Toro Commercial Products Distributor for assistance with this issue. Please reference Commercial Service Bulletin Greens Reels 05-12 when making your inquiry.