Customer Service Bulletin
Commercial Business Group

Greensmaster® Flex 21

Date: February 27, 2003

Model/Serial Range:	Model Number:	Serial Numbers:
	04021	210000101-210001182

Subject: Cutting Unit contacts Traction Drum.

The left hand Pitch Arm (105-2448-01) may bend if the mower impacts solid objects (e.g., curb, trailer, etc.). This can allow the cutting unit to move rearward and contact the traction drum during operation. This condition causes no operating difficulty, but will mar the surface of the aluminum traction drum.

If contact is noted between the left side of the cutting unit and the traction drum, Stop Plate (106-8447) is available for installation. The Stop Plate strengthens the connection area to resist bending from impacts (e.g. loading into a trailer) and provides a limit for allowable rearward movement of the cutting unit. The Stop Plate uses existing mounting holes, however longer Screws (33103-016) are to be used for mounting.

If the left Pitch Arm is bent severely, replacement should be considered.

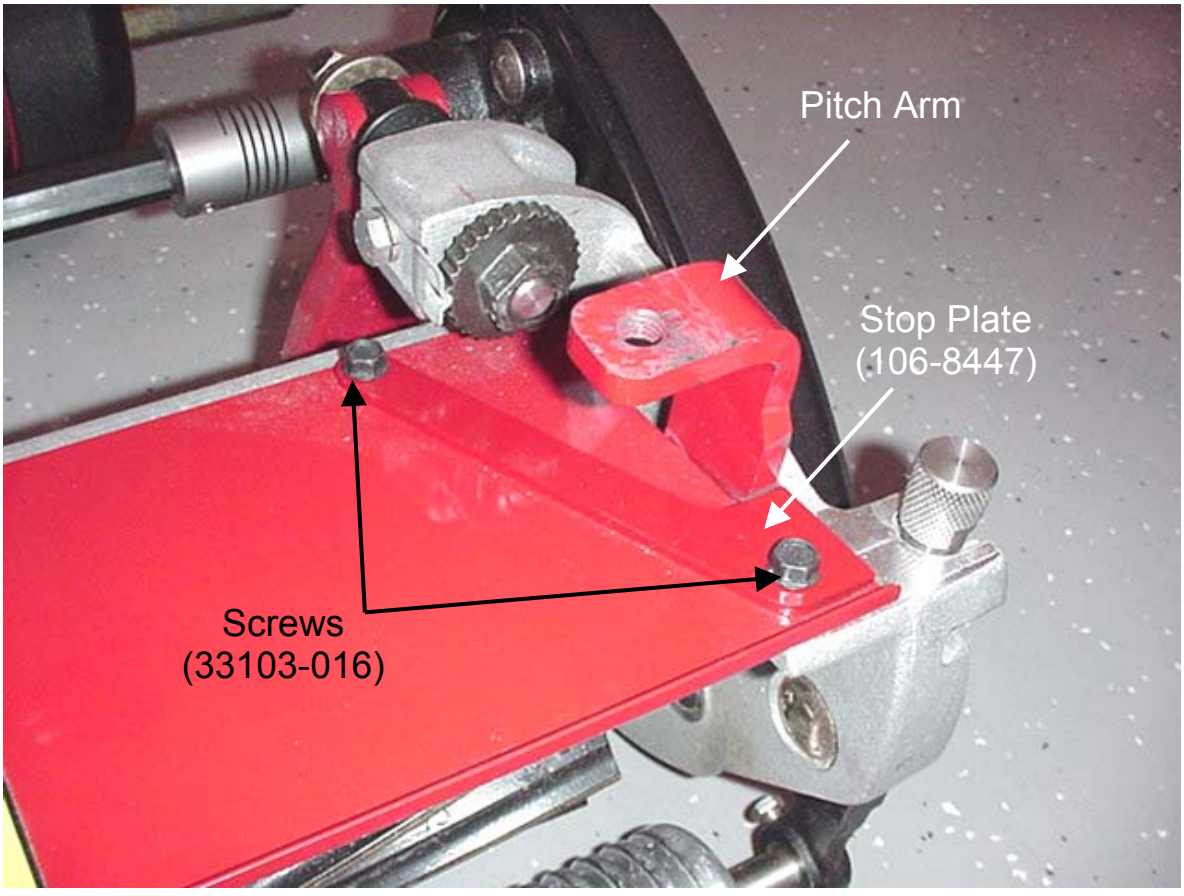

Ref: 14-14 Copyright, 2003. The Toro Company