Customer Service Bulletin
Commercial Business Group

Workman® Topdresser 1800

Model/Serial Range:	Model Number:	Serial Numbers:
	44220	30001-50400

Subject: Lift Cylinder does not align with mounting hole.

The Lift Cylinder is 1 inch (25mm) longer on Workman Traction Units beginning with Serial Number 60001 to provide an improved lifting height in flatbed accessory applications. Due to this change, the lift cylinder will not connect properly to the frame of a Topdresser with a serial number in the range listed on this bulletin.

In instances where the Topdresser 1800 is only installed to the Workman for short period of service then removed, it may be unnecessary/unimportant to connect the lift cylinders to the Topdresser. However, the frame of the Topdresser may be modified by adding new mounting hole locations, if connection of the cylinders is desirable.

Instructions are included with this bulletin to change the Cylinder mounting hole locations.

IMPORTANT NOTES:

1. If the rod end of the Lift Cylinder is not connected, the Lift Lever must be locked-out to prevent accidental engagement. Allowing a cylinder to extend when disconnected may result in damage.
2. Always use the correct Topdresser cylinder mounting holes when connecting to the Workman Vehicle. Failure to connect to the same hole on each side may cause twisting and result in frame damage.

Locate new hole 1” (25.4mm) from small hole in mounting frame.

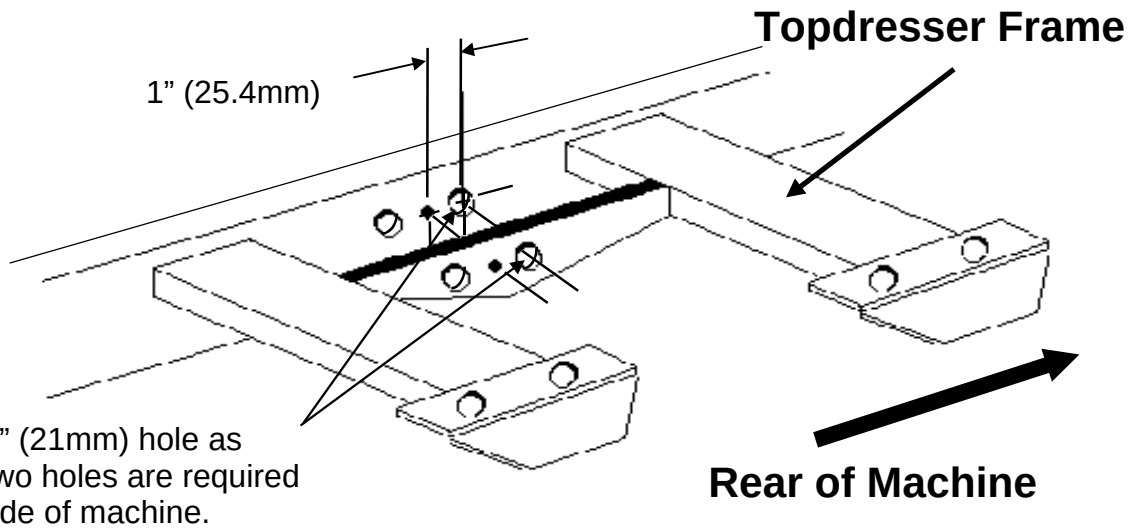

Add 13/16” (21mm) hole as shown. Two holes are required on each side of machine.

Ref: 19-01 Copyright©, 1996. The Toro Company