Customer Service Bulletin
Commercial Business Group

MultiPro® Foam Marker Kit

Date: May 14, 2003

***Revised – Replace previous version (Part callouts on Customer Bulletin switched)**

Model/Serial Range:	**Model Number:**	**Serial Numbers:**
	41572	**230000103-230000347**

Note: Used on 41106, 41107 and 41568

Subject: **Performance Issues with Foam Marker Kit.**

SITUATION: The Foam Marker tank Fittings (94-7193) and (94-7194) may be installed in reverse locations. Fittings installed incorrectly can create poor foam quantity and quality.

CORRECTION: If a performance issue is noted, inspect the Foam Marker Tank fittings for correct orientation as shown below.

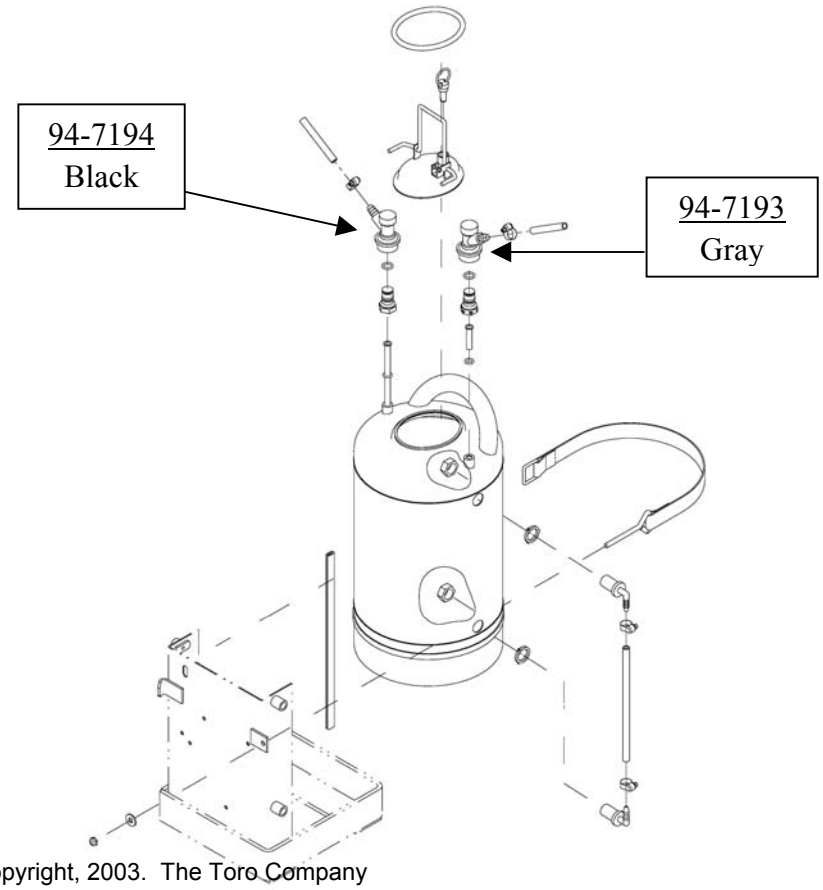

Ref: 18-07.doc Copyright, 2003. The Toro Company