Customer Service Bulletin
Commercial Business Group

Sand Pro® 5020 May 9, 2002

Model/Serial Range:	Model Number:	Serial Numbers:
	08886	80101-210000539

Subject: No Start Condition from Corroded Starter Switch (Key Switch).

The backside of the Starter Switch is susceptible to sand and moisture thrown by the rear wheel as it turns. Chemicals and water associated with turf maintenance can corrode the electrical contacts and result in Switch failure.

A Boot (93-5961) can be installed over the Starter Switch body and connector harness to shield the backside of the Switch from debris and moisture. The Boot must be cut to allow the connector body to pass through Boot. Once installed, secure Boot to harness and Switch body with plastic wire ties. Seal the cuts made to Boot with silicone sealant.

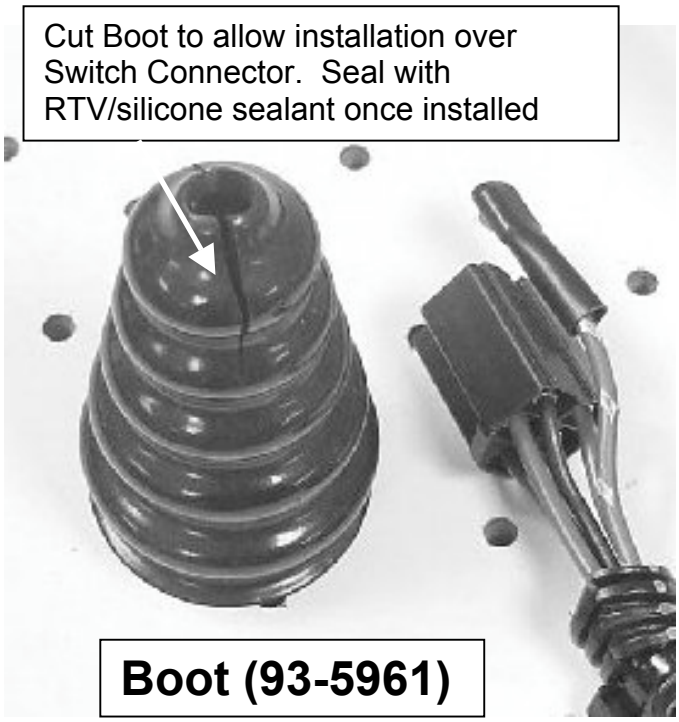

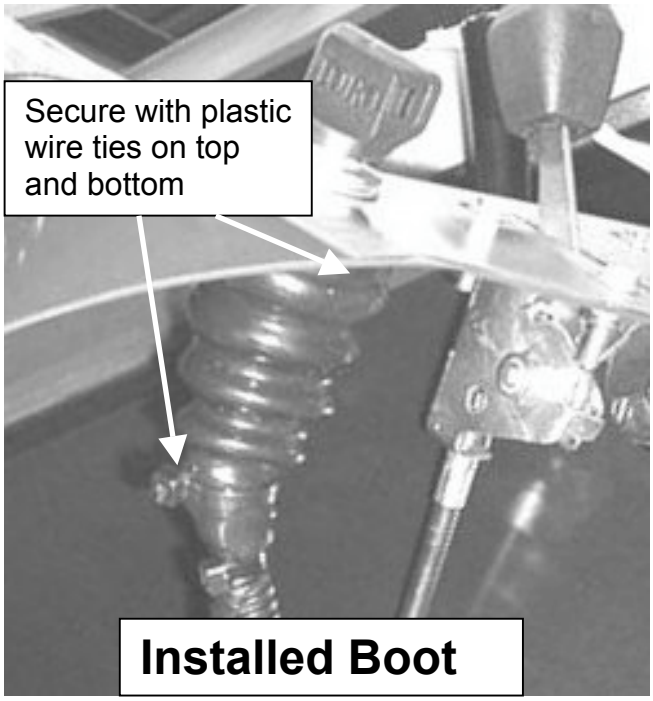

Contact your local authorized Toro distributor for additional information or assistance.

Ref: 16-02 Copyright©, 2002. The Toro Company