Form No. 3326-981

5 and 8 Blade 32in Reel Mower

Reelmaster® 2600–D and 3100–D

Model No. 03212—220000001 and Up

Model No. 03213—220000001 and Up

Parts Catalog

Ordering Replacement Parts

To order replacement parts, please supply: the part number, the quantity, and the description of each part desired.

Understanding Reference Numbers

Each identified part in an illustration has a reference number. The reference number for a part also appears in the parts list, along with other information about the part.

This catalog uses two special reference number formats, one to indicate parts in a service assembly and another to indicate the quantity of a given part in an illustration.

Service Assembly Reference Numbers

Parts in service assemblies have reference numbers in the form **a:b.** The **a** represents the reference number of the entire service assembly and the **b** represents a sequential number unique to each part within the service assembly.

For example, a wheel assembly might be identified by reference number **6**, the tire by **6:1**, the valve by **6:2**, and the wheel by **6:3**. When you order the assembly identified by reference number 6, you receive all parts identified by reference numbers 6:1, 6:2, and 6:3. However, you may also order any part individually.

Reference numbers of this type appear in illustrations and in part lists.

Reference Numbers Indicating Quantity

In an illustration, if a reference number indicates more than one part, the reference number has the form **nX y.** The **n** represents the quantity of the part, the **X** is the multiplication symbol, and the **y** represents the reference number.

For example, in an illustration, the reference number **2X 37** means that two of the parts identified by reference number 37 are indicated.

© The TORO Company — 2002
All Rights Reserved

Contents

Description	Page
Reel Assembly	3
Bedbar Assembly	4
Roller Assembly	5
Gauge Bar, Angle Indicator and Handle Assemblies	6


Accessories

Description	Model / Part No.
Lift Arm Kit (RM2600)	03472
Lift Arm Kit (RM3100)	03221
High HOC Extension Kit	104–1395
Wiehle Roller Kit (3in Dia.)	03234
Wiehle Roller Kit	03475
Full Roller Kit	03479
Sectional Roller Kit	03476
Anti–Scalp Roller Kit	03477
3in Dia. Wiehle Scraper Kit	104–1399
Wiehle Scraper Kit	94–5081
Full Roller Scraper Kit	94–5080
Fixed Cutting Unit Kit	93–6915
Skid Kit	94–3664

Part Description Abbreviations

Part descriptions in this catalog may include the following abbreviations.

Abbreviation	Meaning
AR	as required
ASM	assembly
CARR	carriage
DEG	degrees
FH	flat head
GA	gauge
HF	hex flange
HH	hex head
HHF	hex head flange
HLH	hex lag head
HJ	hex jam
HOC	height-of-cut
HS	hex socket
HSBH	hex socket button head
HSFH	hex socket flat head
HSH	hex socket head
HWH	hex washer head
HWHTF	hex washer head thread forming
HYD	hydraulic
INC	incorporated
LH	left hand
NI	nylon insert
PPH	Phillips pan head
PTH	Phillips truss head
PTO	power take off
RH	right hand
SFH	slotted fillister head
SHH	slotted hex head
SQH	square head
SHWH	slotted hex washer head
SPH	slotted pan head
SRH	slotted round head
STD	standard
TAP	self tapping
TTH	Torx truss head
WH	wing head

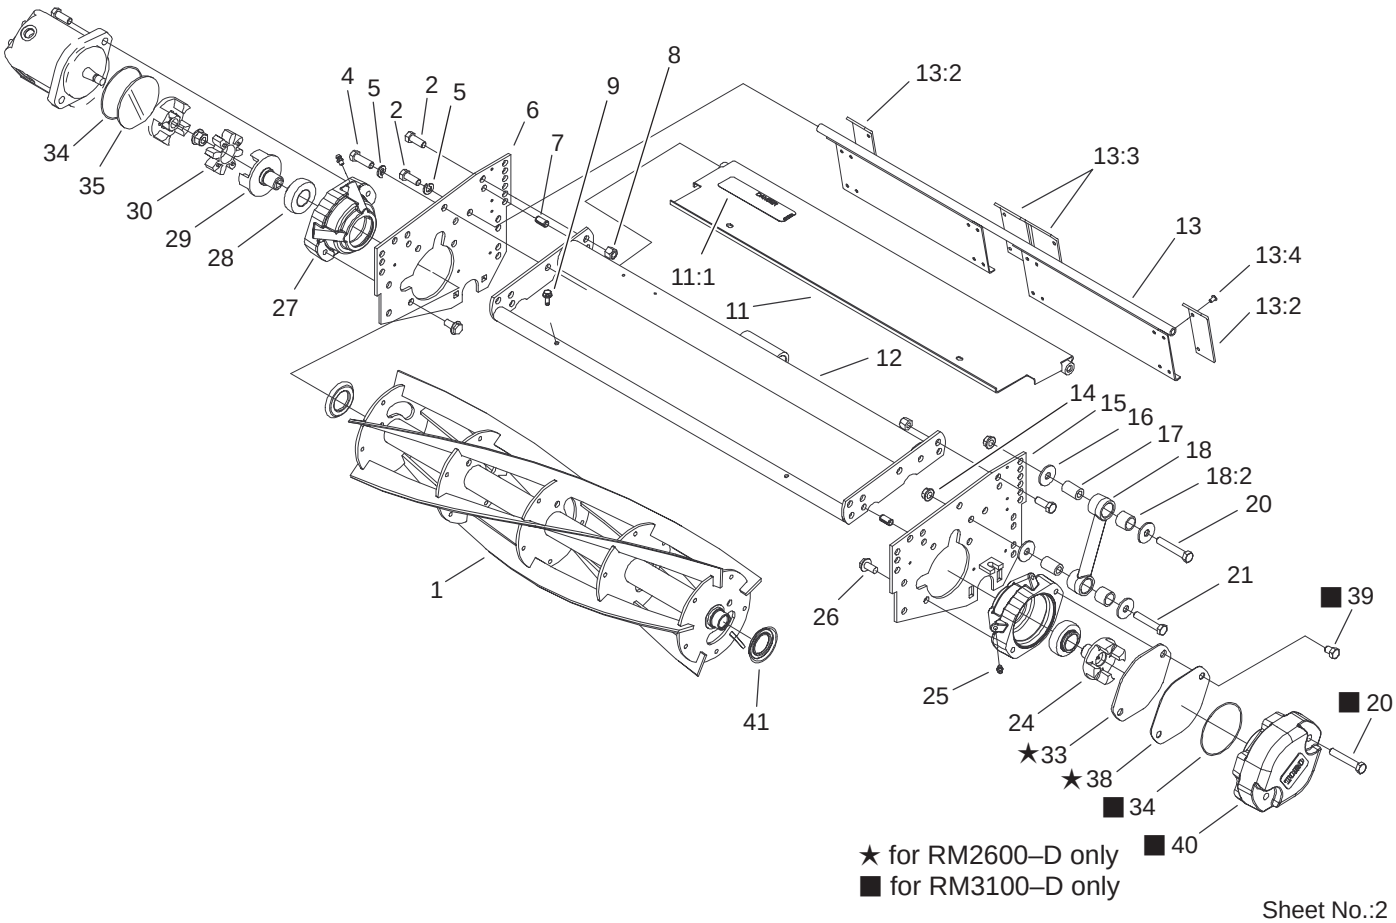


Sheet No.:2

Reel Assembly

Ref. No.	Part No.	Qty.	Description
*1	99–3485	1	Reel–8 Blade (only on: 03213)
1	99–3484	1	Reel–5 Blade (only on: 03212)
2	323–6	10	Screw–HH
4	323–7	2	Screw–HH
5	3253–5	4	Washer–Lock
6	94–3695–01	1	Plate–Side Reel, RH
7	32121–36	4	Pin–Spring
8	3296–39	6	Nut–Lock, NI
9	32144–10	2	Screw–HWH
11	94–5053	1	Front Grass Shield ASM
11:1	94–4584	1	Decal–Danger, Japan
11:1	93–6688	1	Decal–Danger, Europe
11:1	67–7960	1	Decal–Danger
12	95–8755–01	1	Frame–Reel
13	94–4969	1	Rear Grass Shield ASM
13:2	61–3280	2	Flap–Rubber
13:3	61–3290	2	Flap–Rubber, Middle
13:4	700382	12	Rivet
14	32128–36	8	Nut–HF
15	94–3697–01	1	LH Side Plate ASM
16	93–8806	16	Washer–Hardened
17	93–6981	8	Spacer

Ref. No.	Part No.	Qty.	Description
18	16–9759	4	Link And Bushing ASM
18:2	94–8945	2	Bushing
20	323–11	6	Screw–HH
21	323–10	4	Screw–HH
24	93–8826	1	Coupler–Reel, LH Thread
25	302–5	4	Fitting–Grease
26	3234–1	4	Screw–HHF
27	99–3404	2	Housing–Bearing
28	100–4926	2	Bearing–Aligning, Self
29	93–8825	1	Coupler–Reel, RH Thread
30	93–8827	1	Spider–Coupler
33	94–5979	1	Gasket
34	353–949	2	O–Ring
35	94–2703	1	Plug
38	93–6960	1	Cover–Holder, Bearing
39	323–2	2	Screw–HH
40	105–0171–03	1	Weight–End
41	105–6761	2	Seal–Guard (only on: 03213)

* Not illustrated

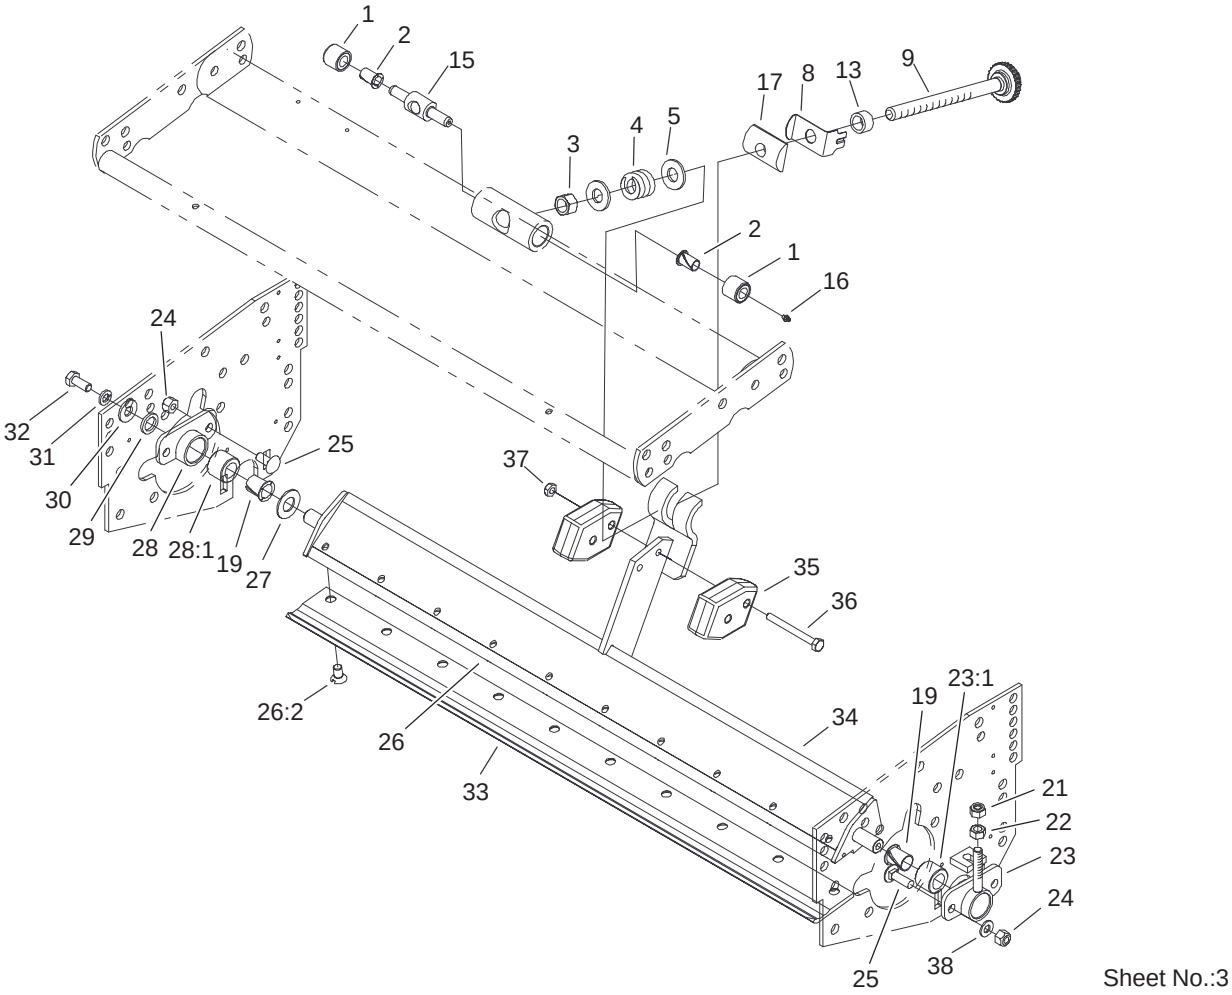


Sheet No.:3

Bedbar Assembly

Ref. No.	Part No.	Qty.	Description
1	62–5510	2	Bushing–Rubber
2	52–2890	2	Bushing–Nylon
3	3296–62	1	Nut–Lock NI
4	57–5270	1	Spring–Comp
5	29–8910	2	Washer
8	95–8752	1	Spring
9	95–8877	1	Bedbar Adjuster ASM
13	93–2959	1	Spacer–Adjuster
15	57–5260	1	Pivot–Bedbar
16	302–18	1	Fitting–Grease
17	93–2892	1	Pivot–Bedbar, Main Adj
19	56–9520	2	Bushing–Flanged
21	3296–4	1	Nut–Lock, NI
22	3219–2	1	Nut–Hex
23	16–9769	1	Bedbar Adj. Housing & Bushing ASM
23:1	56–9510	1	Bushing ASM
24	3296–29	4	Nut–Lock, NI
25	3230–2	4	Screw–CARR
☆26		1	Bedbar ASM
26:2	57–4910	12	Screw
27	61–1950	1	Washer–Bedbar
28	14–4459	1	Housing–Bedbar
28:1	56–9510	1	Bushing ASM
29	62–7120	1	Washer

Ref. No.	Part No.	Qty.	Description
30	3256–56	1	Washer–Flat
31	3253–4	1	Washer–Lock
32	322–3	1	Screw–HH
33	94–5079	1	Bedknife
33	104–1381	1	Bedknife–Duty, Heavy
34	95–8748–01	1	Bedbar Machining
35	99–3472	2	Weight–Lead (only on: 03213)
36	321–15	2	Screw–HH (only on: 03213)
37	32146–17	2	Nut–Lock (only on: 03213)
38	3256–74	4	Washer–Flat

☆ Not serviced

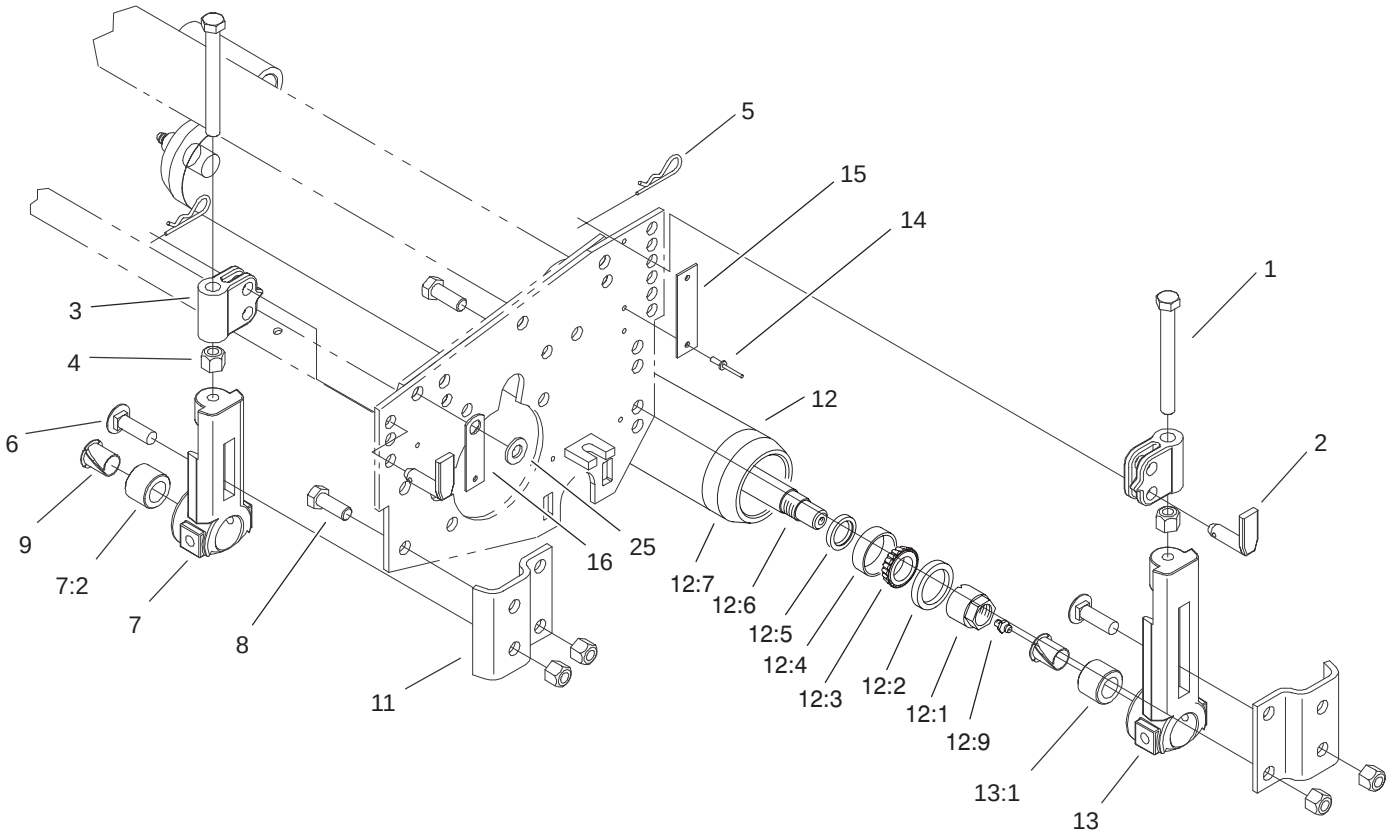



Sheet No.:4


Roller Assembly

Ref. No.	Part No.	Qty.	Description
1	323–57	4	Screw–HH
2	71–3690	4	Spade–Bent
3	61–0420–01	4	Support–HOC
4	3296–39	16	Nut–Lock, NI
5	3290–467	4	Pin–Hair
6	3231–25	4	Screw–CARR
7	14–4489	2	Front HOC Bracket ASM
7:2	56–9510	1	Bushing ASM
8	323–6	8	Screw–HH
9	56–9520	2	Bushing–Flanged
11	61–0910	4	Bracket–Angle
12	94–4982	1	Full Roller ASM
12:1	71–3590	2	Nut–Adjustment
12:2	105–0150	2	Seal–Grease
12:3	254–78	2	Bearing–Cone
12:4	254–79	2	Bearing–Roller, Cup
12:5	253–152	2	Seal–Oil
12:6	105–0158	1	Shaft–Roller
12:7	61–0380	2	Cap–End, Roller
12:9	302–5	2	Fitting–Grease
13	14–4479	2	Rear HOC Bracket And Bushing ASM
13:1	56–9510	1	Bushing ASM
14	3290–55	8	Rivet–Pop
15	61–3800	2	Plate–Rear
16	61–3790	2	Plate–HOC, Front
25	3256–38	2	Washer–Flat

3326–981

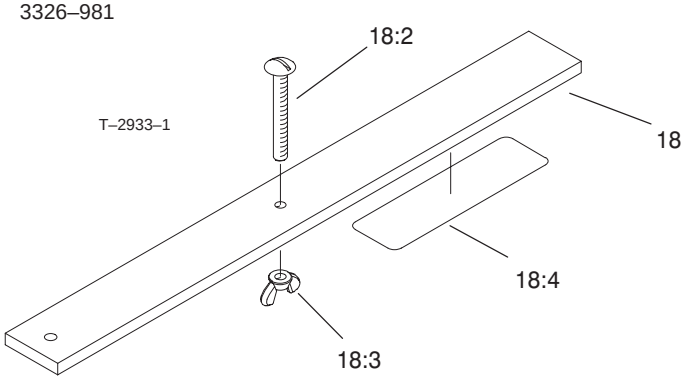

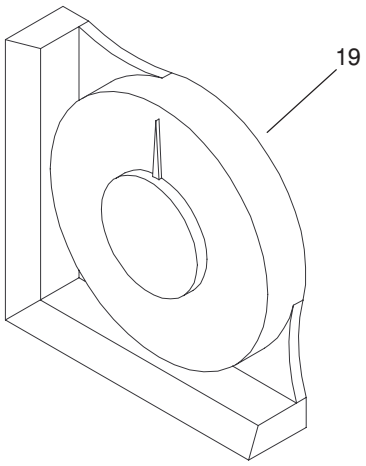

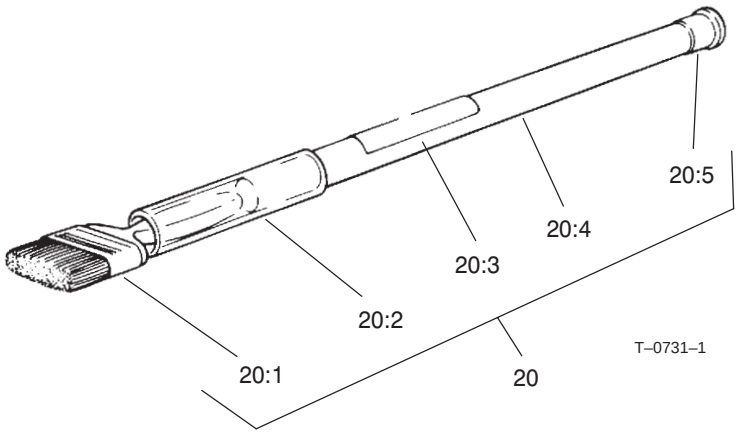

Sheet No.:1

Gauge Bar, Angle Indicator and Handle Assemblies

Ref. No.	Part No.	Qty.	Description
18	98–1852	1	Gauge Bar ASM
18:2	32122–54	2	Screw–Head, Truss
18:3	32103–3	2	Nut–Wing
18:4	98–7976	1	Decal–Bar, Gauge
19	99–3503	1	Indicator–Angle
20	29–9100	1	Handle ASM
20:1	36–4310	1	Brush
20:2	29–9090	1	Hose–Handle
20:3	12–9140	1	Decal–Body, Front
20:4	29–9080	1	Handle
20:5	2410–18	1	Cap–Plastic

Ref. No.	Part No.	Qty.	Description

Maintenance Record

Date								


TORO®