

#### Harness Routing Kit Z Master<sup>®</sup> Professional 7500-D Series Riding Mower

Model No. 147-7843

Installation Instructions

#### Loose Parts

Use the chart below to verify that all parts have been shipped.

Description	Qty.	Use
No parts required	-	Prepare the machine.
Support bracket	1	
Tie clip	6	Install the kit.
Plastic plug	3	
Self-tapping screw (1/4 x 5/8 inch)	2	

**Note:** Determine the left and right sides of the machine from the normal operating position.

# **Preparing the Machine**

- 1. Park the machine on a level surface.
- 2. Move the motion-control levers to the NEUTRAL-LOCK position.
- 3. Engage the parking brake.
- 4. Shut off the engine, remove the key, and wait for all movement to stop before you leave the operator's position.
- 5. Allow the machine to cool before adjusting, servicing, cleaning, or storing it.



# Installing the Kit

- 1. Raise the seat to the service position.
- 2. Remove and discard the 3 tie clips securing the wire harness (Figure 1).
- 3. Remove and discard the 3 plastic plugs securing the heat-deflector panel (Figure 1).



Figure 1

- 4. Remove the heat-deflector panel.
- 5. Remove and discard the 2 tie clips securing the wire harness (Figure 2).

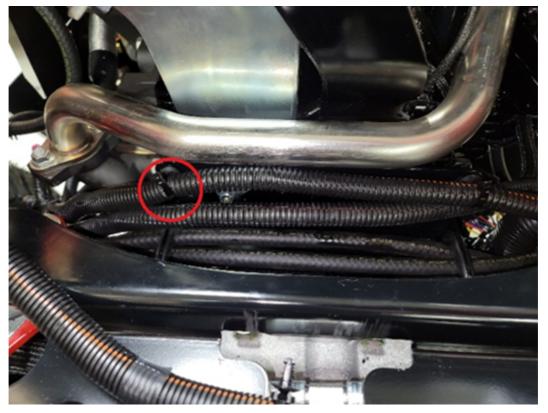


Figure 2

6. Move the wire harness away from the bracket to access the 2 clip-mounting holes (Figure 3).



Figure 3

g433175

7. Secure the new support bracket using the 2 self-tapping screws (1/4 x 5/8 inch) as shown in Figure 4.

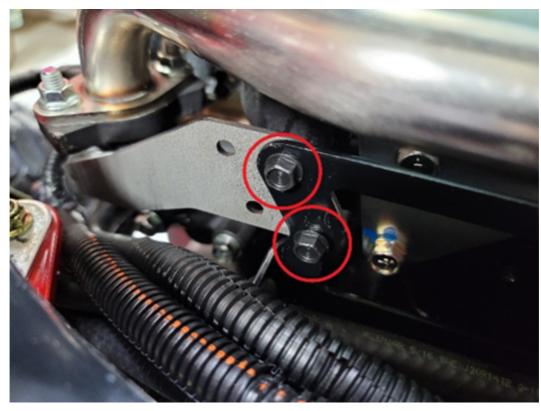


Figure 4

8. Secure the wire harness to the support bracket using 2 tie clips (Figure 5).



Figure 5

9. Ensure that both wire harnesses are secure, then cut the excess from the tie clips (Figure 6).

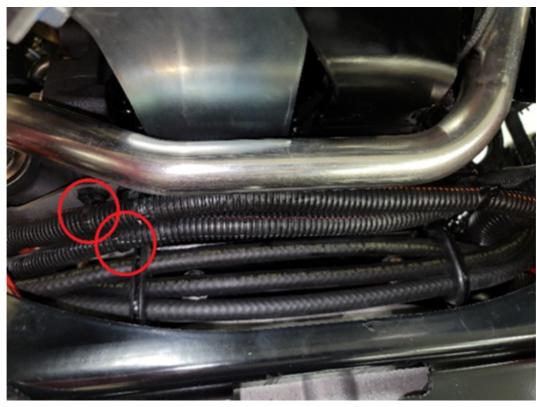


Figure 6

g433176

10. Secure both wire harnesses to the long end of the bracket using 1 tie clip, then cut the excess from the tie clip (Figure 7).



Figure 7

- 11. Secure the heat-deflector panel using 3 plastic plugs (Figure 8).
- 12. Secure the wire harness to the heat-deflector panel using 3 tie clips (Figure 8).

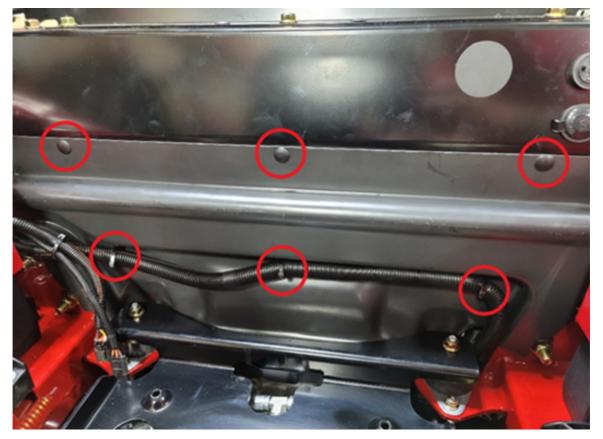


Figure 8



### Count on it.