


Groundsmaster® 3500-D

Model/Serial Range: Model Numbers: Serial Numbers:

30821 200000101-210000300 30822 (rotary deck) 200000101-210002000

Subject: Rear roller shafts may come loose and rotate in the mount.

The rear roller shaft may loosen from forces such as impacts from rough terrain and allow the shaft to rotate in the mounts. Roller shafts that have rotated should be repaired using this latest design, which uses a hardened roller shaft with a flat spot for the capscrew to contact and prevent rotation. Roller Service Kit (104-4869) contains the necessary parts to repair one deck. Retain this figure for proper identification.

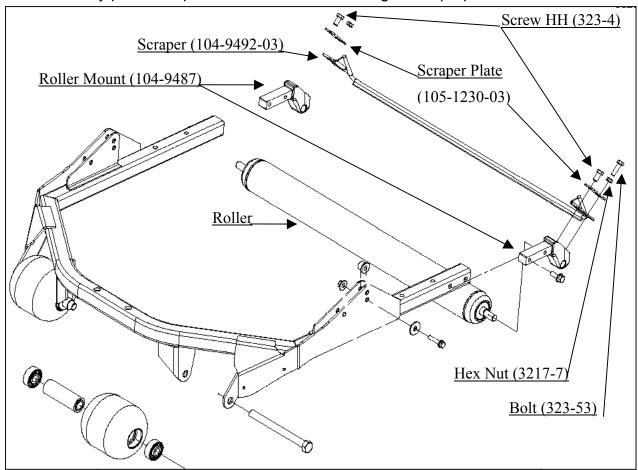

Roller Service Kit 104-4869		
QTY	Part Number	Description
2	104-9487	Roller Mount
1	105-1227	Roller
1	104-9492-03	Scraper
2	105-1230-03	Scraper Plate
2	323-4	Screw-HH
2	323-53	Bolt
2	3217-7	Hex Nut

Ref: 14-21 Copyright[©], 2001. The Toro Company