

Multi Pro® / Workman® Spray Systems

Model/Serial Range:	Model Number:	Serial Numbers:
	41564	70101-80196
	41128	00000-99999
	41222	00000-99999
	41130	00000-99999
	41223	00000-99999

Subject: Quick Couplers in the pressure circuit may unlatch

The Quick Couplers used in the <u>pressure circuit</u> of some spray systems do not include a positive locking device and could accidentally unlatch while the system is pressurized. If the Quick Coupler becomes unlatched, the contents of the sprayer tank will be immediately expelled to the ground and may splash onto bystanders.


A replacement Quick Coupler with Locking Latch Pins, as shown below, is available for installation at no charge through your local Toro distributor.). DO NOT use non-locking Quick Couplers in the pressure circuit. Contact your local Toro distributor for details regarding this program.

WARNING: Failure to comply with this bulletin may lead to personal injury.

Replace this Quick Coupler, if found in the pressure circuit



Replacement Quick Coupler with Locking Latch Pins

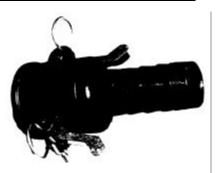

Ref: 17-10.doc Copyright[®], 1998. The Toro Company