



Customer Service Bulletin Commercial Business Group

Pro Core® Series 440, 660 and 880 Aerator

Date: July 08, 2003

Model/Serial Range: **Model Number:**

09700

09701

09702

Serial Numbers:

200000001-220999999

200000001-220999999

200000001-220999999

Subject: Belt Slip and Turf Damage due to improper Gearbox Installation.

If the belts appear to slip during operation, confirm the belts are adjusted properly as identified in the Operator's Manual. As the gearbox is symmetrical, it can be installed upside down resulting in reversed rotation. Proper installation can be determined by turning the gearbox-input shaft as shown in Figure 1. If the crank arms rotate in the direction shown in Figure 2, the gearbox is installed properly.



Figure 1

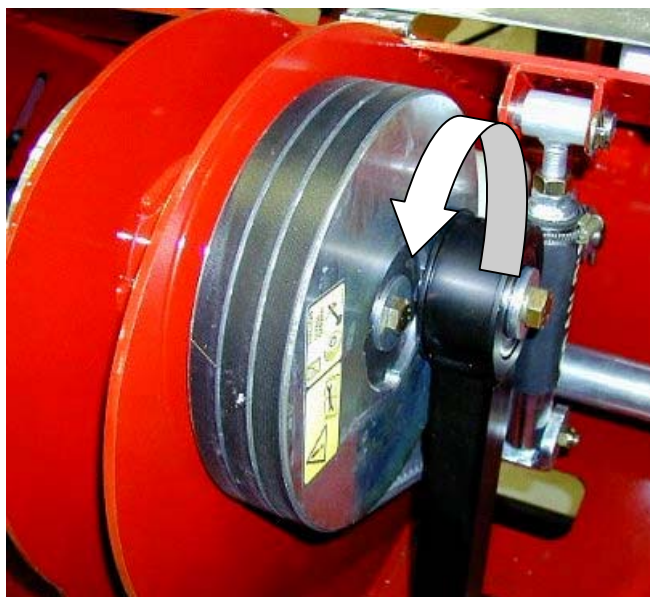


Figure 2